

## UPDATE (SOFTWARE)


Updates the software running on the 7000 series device via USB stick.

**WARNING: An update requires the 7000 series software to restart upon completion. It is also advised to BACKUP your settings to the USB stick. Refer to our before updating your software.**


The 7000 can update can be retrieved via the Farmscan Ag website:

### Direct from the Farmscan Ag website

1. Have a USB to hand that is completely empty & insert into your PC
2. Open a web browser and enter the following web address :
3. <http://www.farmscanag.com/support/software-updates>
4. Select the Product category, 7000 Series and follow the link to download the update.
  - a. NB : You will be required to supply your name and a valid email address.
5. Once completed, you will be prompted to download and SAVE this File
6. Press OK

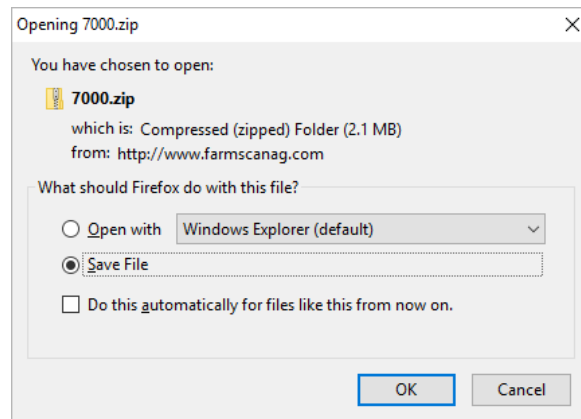


7. In most cases, the file will be downloaded to your DOWNLOADS folder on your windows PC. This can be found by opening your Windows Explorer and navigating to this folder.
8. Right Click the 7000.zip folder and select EXTRACT ALL. Follow the prompts.

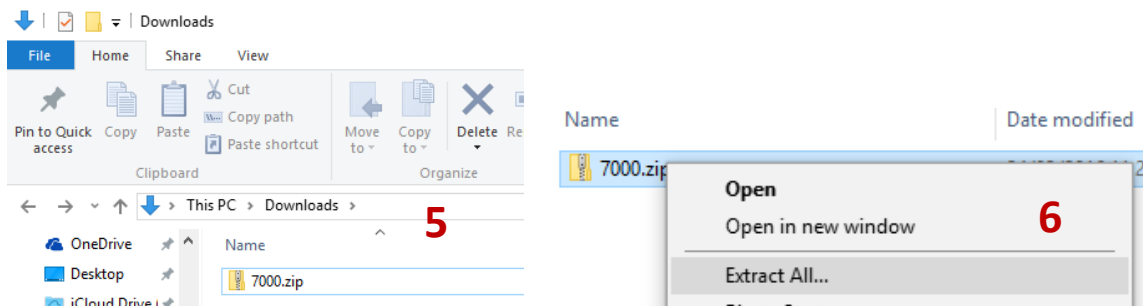


9. The window will now show the extracted 7000 file, and a new folder called 7000
10. Open the 7000 folder to reveal the 7000 File.

11. Right click on this and select SEND TO > USB (or it might simply be the drive letter of the USB)

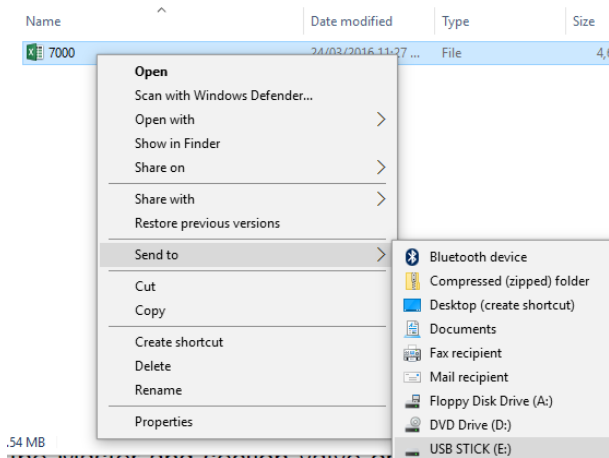

a. Alternatively, you may simply COPY & PASTE the above file direct onto your USB stick.

12. Navigate to your USB stick and confirm the 7000 file has copied over correctly.

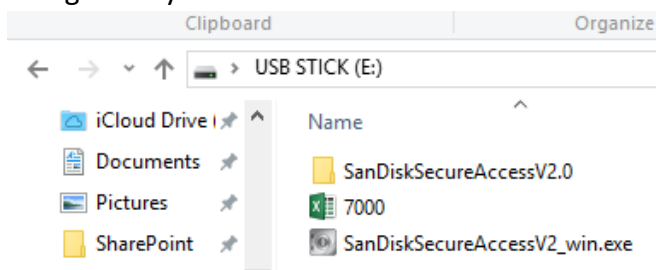

13. Eject the USB stick safely and insert into the USB socket on the AC-7000 cable at the rear of the 7000 unit

14. **BACKUP** your existing settings. Refer to our main manual.

15. Once the USB stick is inserted, Select **UPDATE > BEGIN UPDATE**

16. The update will search the USB drive for the 7000 file and proceed with the update.

- a. The following Status bar reveals the following if the upgrade does not work
- 10% - Internal system error – retry – fails again restart
  - 20% - No USB detected – re-plug in – happens again – restart 7000
  - 30% - Copy failed – instructions not followed – try again. OR change USB brand
  - 60% - Update settings failed – retry update
  - 70% - Old version clearing failed – retry update
  - 80% - Update naming failed – retry update

17. If the unit completes to 100%, the update has been successful and the unit will reboot. Any problems regarding the above upgrade should be directed to a Farmscan Ag team member for assistance.

**Note : Some USB drives may not work with the 7000 device. Known tested USB drives include Sandisk, Kingston, Toshiba, Strontium. Please do not use Lexar Jumpdrives.**



Do not attempt this without advice from the Farmscan Ag service department.